

DEPARTMENT OF TRANSPORTATION

DIVISION OF ENGINEERING SERVICES

Office of Structural Materials

Quality Assurance and Source Inspection



Bay Area Branch
690 Walnut Ave.St. 150
Vallejo, CA 94592-1133
(707) 649-5453
(707) 649-5493

Contract #: 04-0120F4Cty: SF/ALA Rte: 80 PM: 13.2/13.9File #: 69.28**WELDING INSPECTION REPORT****Resident Engineer:**Siegenthaler, Peter**Address:** 333 Burma Road**City:** Oakland, CA 94607**Report No:** WIR-017855**Date Inspected:** 08-Oct-2010**Project Name:** SAS Superstructure**OSM Arrival Time:** 700**Prime Contractor:** American Bridge/Fluor Enterprises, a JV**OSM Departure Time:** 1900**Contractor:** Zhenhua Port Machinery Company, Ltd (ZPMC), Changxing Island **Location:** Shanghai, China**CWI Name:** Liu Hua Jie**CWI Present:** Yes No**Inspected CWI report:** Yes No N/A**Rod Oven in Use:** Yes No N/A**Electrode to specification:** Yes No N/A**Weld Procedures Followed:** Yes No N/A**Qualified Welders:** Yes No N/A**Verified Joint Fit-up:** Yes No N/A**Approved Drawings:** Yes No N/A**Approved WPS:** Yes No N/A**Delayed / Cancelled:** Yes No N/A**Bridge No:** 34-0006**Component:** Orthotropic Box Girder(OBG)**Summary of Items Observed:**

On this day CALTRANS OSM Quality Assurance (QA) Inspector Manoj Prabhune was present during the times noted above for observations relative to the fabrication of the SAS Superstructure being performed by Zhenhua Port Machinery Company (ZPMC) at Changxing Island in Shanghai, China. QA observed and/or found the following:

This QA Inspector randomly observed the following work in progress:

OBG # TRIAL ASSEMBLY YARD

WELDING**Segment # 11BW**

This QA inspector observed ZPMC qualified welding personnel identified as 046709 perform Shielded Metal Arc Welding (SMAW), weld joint identified as SEG067A-021; located On Orthotropic Box Girder (OBG) Bottom Plate to Side Plate. ZPMC Quality Control (QC) is identified as Mr. Wang Zhu. The welding variables recorded by QC appeared to comply with the Applicable WPS-B-P-2214-B-U2-FCM-1 See the attached Photo

Segment # 11AE ~ 11BE

This QA inspector observed ZPMC qualified welding personnel identified as 040367 perform Shielded Metal Arc Welding (SMAW), weld joint identified as SP700-001-021; located On Orthotropic Box Girder (OBG) Corner Assembly Side Plate to I-Rib Hold Back Joint. ZPMC Quality Control (QC) is identified as Mr. Wang Li Yang.

WELDING INSPECTION REPORT

(Continued Page 2 of 3)

The welding variables recorded by QC appeared to comply with the Applicable WPS-B-T-2132. See the attached Photo.

Segment # 11AE ~ 11BE

This QA inspector observed ZPMC qualified welding personnel identified as 052763 perform Shielded Metal Arc Welding (SMAW), weld joint identified as SP714-001-031; located On Orthotropic Box Girder (OBG) Corner Assembly I-Rib to I-Rib CJP Joint. ZPMC Quality Control (QC) is identified as Mr. Wang Li Yang. The welding variables recorded by QC appeared to comply with the Applicable WPS-B-T-2233-B-U2-F.

Segment # 11AW ~ 11BW

This QA inspector observed ZPMC qualified welding personnel identified as 046709 perform Shielded Metal Arc Welding (SMAW), weld joint identified as CA079-005; located On Orthotropic Box Girder (OBG) Side Plate to Edge Plate Joint. ZPMC Quality Control (QC) is identified as Mr. Wang Zhu. The welding variables recorded by QC appeared to comply with the Applicable WPS-B-P-2214-TC-U4b-FCM-1

Segment # 11BE

This QA inspector observed ZPMC qualified welding personnel identified as 047353 perform Flux Core Arc Welding (FCAW), weld joint identified as SP700-001-033; located On Orthotropic Box Girder (OBG) Side Plate T-Rib Hold Back Weld. ZPMC Quality Control (QC) is identified as Mr. Wang Li Yang. The welding variables recorded by QC appeared to comply with the Applicable WPS-B-T-2132.

Segment # 11AE ~ 11BE

This QA inspector observed ZPMC qualified welding personnel identified as 053871 perform Shielded Metal Arc Welding (SMAW), weld joint identified as SEG068A-043; located On Orthotropic Box Girder (OBG) Bottom Plate to Side Plate CJP Weld. ZPMC Quality Control (QC) is identified as Mr. Wang Li Yang. The welding variables recorded by QC appeared to comply with the Applicable WPS-B-T-2213-B-U2-FCM-1.

Segment # 11AE ~ 11BE

This QA inspector observed ZPMC qualified welding personnel identified as 053871 perform Shielded Metal Arc Welding (SMAW), weld joint identified as SEG068A-043; located On Orthotropic Box Girder (OBG) Bottom Plate to Side Plate CJP Weld. ZPMC Quality Control (QC) is identified as Mr. Wang Li Yang. The welding variables recorded by QC appeared to comply with the Applicable WPS-B-T-2213-B-U2-FCM-1.



Segment # 11AE

This QA inspector observed ZPMC qualified welding personnel identified as 052763 perform Shielded Metal Arc Welding (SMAW), weld joint identified as EP170-001-009; located On Orthotropic Box Girder (OBG) Bottom Plate to Side Plate CJP Weld. ZPMC Quality Control (QC) is identified as Mr. Wang Li Yang. The welding variables recorded by QC appeared to comply with the Applicable WPS-B-T-2132.

Unless otherwise noted, all work observed on this date appeared to generally comply with applicable contract documents.

WELDING INSPECTION REPORT

(Continued Page 3 of 3)

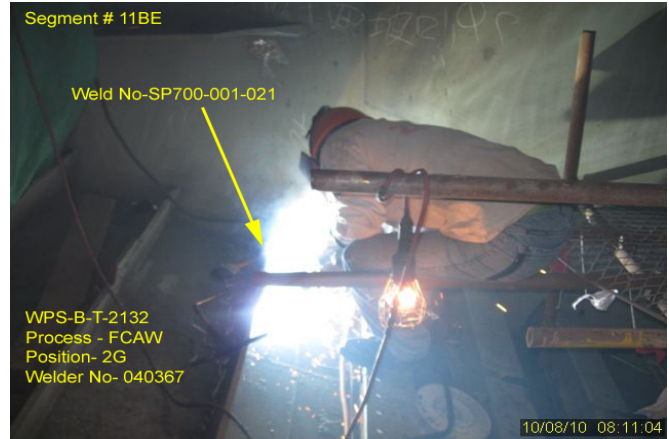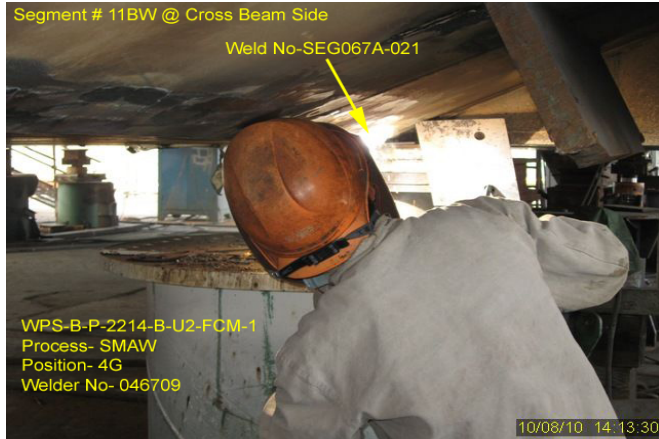

Summary of Conversations:

Only general conversation was held between QA and QC concerning this project.

Comments

This report is for the purpose of determining conformance with the contract documents and is not for the purpose of making repair or fit for purpose recommendations. Should you require recommendations concerning repairs or remedial efforts please contact Eric Tsang phone: 15000422372, who represents the Office of Structural Materials for your project.

Inspected By:	Prabhune,Manoj	Quality Assurance Inspector
Reviewed By:	Patterson,Rodney	QA Reviewer
